



now hear this.

# PVC Pro Channel Tracking Problem

## Bug Fix Guide

### 1. Description

Some PVC Pro passive volume controllers have had a problem with channel tracking due to an unfortunate manufacturing bug. Usually this will show up when you turn the volume knob all the way down, and you can still hear a faint sound coming out of the right speaker. Luckily this can be fixed very easily by following the instructions below. If in any case you have any doubts or you have more questions about this guide, please feel free to contact us by phone at 707.747.0122 or by email [engineering@nhthifi.com](mailto:engineering@nhthifi.com).

### 2. Do I Need To Fix My PVC Pro?

If your PVC Pro has an oval logo at the front, three feet instead of four on the bottom, and the Jensen transformers inside, you do.

### 3. Tools You Need

- ✓ A Philips screwdriver (PH1)
- ✓ A pair of sharp wire cutters

Main 707.747.0122  
Fax 707.747.1252

6400 Goodyear Road  
Benicia, CA 94510 USA

[www.nhtxd.com](http://www.nhtxd.com)  
[www.nhthifi.com](http://www.nhthifi.com)  
[www.nhtpro.com](http://www.nhtpro.com)





now hear this.

#### 4. Step-by-step instructions

- a. Remove the four cover screws located at the bottom and the one located between the input and output connectors on the back of your PVC.



- b. Slide the cover off. It might be little tight, so be careful!




Main 707.747.0122  
Fax 707.747.1252  
6400 Goodyear Road  
Benicia, CA 94510 USA  
[www.nhtxd.com](http://www.nhtxd.com)  
[www.nhthifi.com](http://www.nhthifi.com)  
[www.nhtpro.com](http://www.nhtpro.com)






now hear this.

- c. Find the jumper connector JC10 from the board. It is located just behind the right output connector.

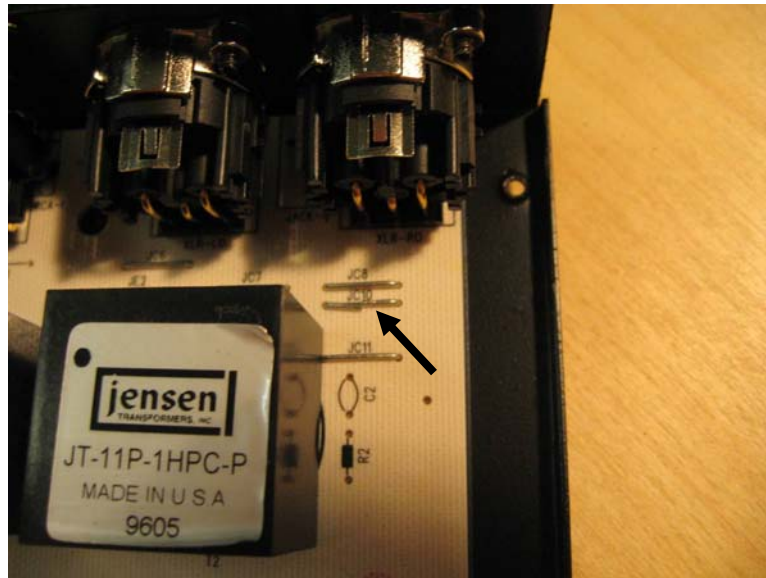

- d. Using your wire cutters, cut the jumper off.

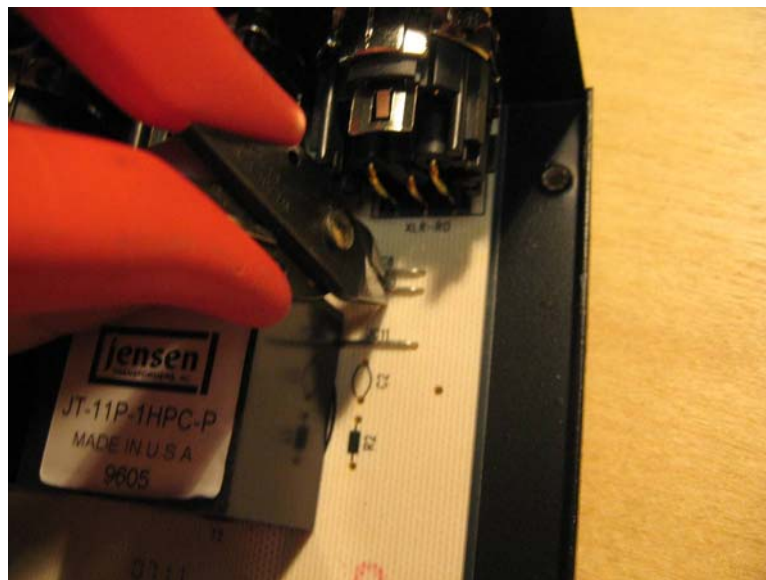


Main 707.747.0122  
Fax 707.747.1252  
6400 Goodyear Road  
Benicia, CA 94510 USA  
[www.nhtxd.com](http://www.nhtxd.com)  
[www.nhthifi.com](http://www.nhthifi.com)  
[www.nhtpro.com](http://www.nhtpro.com)





now hear this.

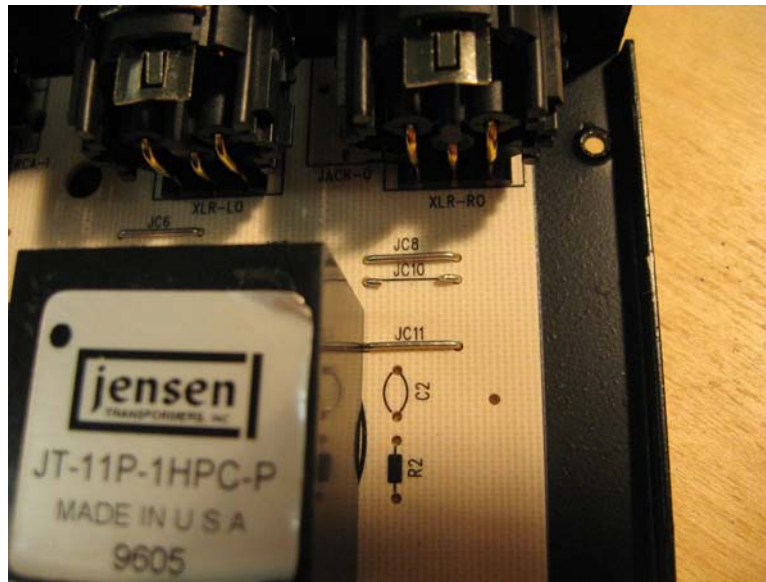

e. Slide the cover back on and apply the cover screws.

f. Done!

Main 707.747.0122  
Fax 707.747.1252  
6400 Goodyear Road  
Benicia, CA 94510 USA  
[www.nhtxd.com](http://www.nhtxd.com)  
[www.nhthifi.com](http://www.nhthifi.com)  
[www.nhtpro.com](http://www.nhtpro.com)

